

TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

SECTION 1. PRODUCT AND COMPANY IDENTIFICATION

Product name : TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Product code : 100000014421

Manufacturer or supplier's details

Company : TEC Specialty Products

Address : 1105 South Frontenac

Aurora, IL, 60504

Telephone : 800-832-9023

Medical Emergency Phone Number (24 Hours): 1-800-424-9300

Transport Emergency Phone Number (CHEMTREC): 1-800-424-9300

Recommended use of the chemical and restrictions on use

Recommended use : Cement, Adhesive

SECTION 2. HAZARDS IDENTIFICATION

Emergency Overview

Appearance	powder
Color	gray
Odor	odorless

GHS Classification

Skin irritation : Category 2
Serious eye damage : Category 1
Skin sensitization : Category 1

Specific target organ toxicity - : Category 3 (Respiratory system)

single exposure

GHS label elements

Hazard pictograms



Signal Word : Danger

Hazard Statements:

H315 Causes skin irritation. H317 May cause an allergic skin reaction. H318 Causes serious eye damage. H335 May cause respiratory irritation.



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

Precautionary Statements:

Prevention: P261 Avoid breathing dust. P264 Wash skin thoroughly after handling. P271 Use only outdoors or in a well-ventilated area. P272 Contaminated work clothing must not be allowed out of the workplace. P280 Wear protective gloves/ eye protection/ face protection.

Response: P302 + P352 IF ON SKIN: Wash with plenty of soap and water. P304 + P340 + P312 IF INHALED: Remove person to fresh air and keep comfortable for breathing. Call a POISON CENTER/ doctor if you feel unwell. P305 + P351 + P338 + P310 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a POISON CENTER/ doctor. P333 + P313 If skin irritation or rash occurs: Get medical advice/ attention. P362 Take off contaminated clothing and wash before reuse.

Storage: P403 + P233 Store in a well-ventilated place. Keep container tightly closed. P405 Store locked up.

Disposal: P501 Dispose of contents/ container to an approved waste disposal plant.

Potential Health Effects

Carcinogenicity:

IARC Group 1: Carcinogenic to humans

Quartz (SiO2) 14808-60-7

Group 1: Carcinogenic to humans

OSHA No component of this product present at levels greater than or

equal to 0.1% is on OSHA's list of regulated carcinogens. No component of this product present at levels greater than or

equal to 0.1% is on OSHA's list of regulated carcinogens.

NTP Known to be human carcinogen

Quartz (SiO2) 14808-60-7

sulphur trioxide 7446-11-9

Known to be human carcinogen

SECTION 3. COMPOSITION/INFORMATION ON INGREDIENTS

Substance / Mixture : Mixture

Hazardous ingredients

Chemical name	CAS-No.	Concentration [%]	
Cement, portland, chemicals	65997-15-1	30 - 50	
Quartz (SiO2)	14808-60-7	30 - 50	
Calcium carbonate	471-34-1	5 - 10	
Ashes (residues)	68131-74-8	5 - 10	
calcium sulfate	7778-18-9	1 - 5	
Calcium oxide	1305-78-8	1 - 5	
magnesium oxide	1309-48-4	1 - 5	
aluminium oxide	1344-28-1	1 - 5	
calcium diformate	544-17-2	1 - 5	



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

diiron trioxide	1309-37-1	1 - 5
sulphur trioxide	7446-11-9	0.1 - 1
diphosphorus pentaoxide	1314-56-3	0.1 - 1

Actual concentration is withheld as a trade secret

SECTION 4. FIRST AID MEASURES

General advice : In the case of accident or if you feel unwell, seek medical

advice immediately.

If inhaled : If inhaled

Remove person to fresh air. If signs/symptoms continue, get

medical attention.

Oxygen or artificial respiration if needed.

In case of skin contact : Wash off with soap and water.

Remove contaminated clothing. If irritation develops, get

medical attention.

In case of eye contact : Flush eyes with water at least 15 minutes. Get medical

attention if eye irritation develops or persists.

If swallowed : Do not induce vomiting. Seek medical attention if symptoms

develop. Provide medical care provider with this SDS.

If conscious, drink plenty of water.

Never give anything by mouth to an unconscious person.

Most important symptoms and effects, both acute and

delayed

: Causes skin irritation.

May cause an allergic skin reaction.

Causes serious eye damage. May cause respiratory irritation.

SECTION 5. FIRE-FIGHTING MEASURES

Suitable extinguishing media : Use water spray, alcohol-resistant foam, dry chemical or

carbon dioxide.

Unsuitable extinguishing

media

: None known.

Specific hazards during fire

fighting

: Avoid generating dust; fine dust dispersed in air in sufficient concentrations, and in the presence of an ignition source is a

potential dust explosion hazard.

No hazardous combustion products are known

Hazardous combustion

products

: No hazardous combustion products are known

Specific extinguishing



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

methods

Further information : Use extinguishing measures that are appropriate to local

circumstances and the surrounding environment.

Special protective equipment

for fire-fighters

: Wear an approved positive pressure self-contained breathing

apparatus in addition to standard fire fighting gear.

SECTION 6. ACCIDENTAL RELEASE MEASURES

Personal precautions, protective equipment and emergency procedures Environmental precautions : Refer to protective measures listed in sections 7 and 8.

: Prevent product from entering drains.

Should not be released into the environment.

Methods and materials for containment and cleaning up

Use approved industrial vacuum cleaner for removal.
 Do not use compressed air for cleaning purposes.
 Dust deposits should not be allowed to accumulate on surfaces, as these may form an explosive mixture if they are released into the atmosphere in sufficient concentration.

SECTION 7. HANDLING AND STORAGE

Local/Total ventilation : Use only with adequate ventilation.

Advice on safe handling : Avoid creating dust.

Dry powders can build static electricity charges when subjected to the friction of transfer and mixing operations. Take precautionary measures against static discharges. Provide for appropriate exhaust ventilation and dust collection

at machinery.

Conditions for safe storage : Keep tightly closed in a dry and cool place.

Materials to avoid : No special restrictions on storage with other products.

SECTION 8. EXPOSURE CONTROLS/PERSONAL PROTECTION

Ingredients with workplace control parameters

Components	CAS-No.	Value type (Form of exposure)	Control parameters / Permissible concentration	Basis
Cement, portland, chemicals	65997-15-1	TWA	1 mg/m3	ACGIH



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0

Revision Date 04/21/2025

		(Respirable		
		particulate		
		matter)		
		TWA (total dust)	15 mg/m3	OSHA Z-1
		TWÁ	5 mg/m3	OSHA Z-1
		(respirable		
		fraction)		
		TWA (Dust)	50 Million	OSHA Z-3
		, ,	particles per cubic	
			foot	
		TWA (Total)	10 mg/m3	OSHA P0
		TWA	5 mg/m3	OSHA P0
		(Respirable		
		fraction)		
		TWA (Total	10 mg/m3	OSHA P0
		dust)		
		TWA	5 mg/m3	OSHA P0
		(respirable		
		dust fraction)		
		PEL (Total	10 mg/m3	CAL PEL
		dust)		
		PEL	5 mg/m3	CAL PEL
		(respirable		
		dust fraction)		
Quartz (SiO2)	14808-60-7	TWA	0.025 mg/m3	ACGIH
		(Respirable		
		particulate		
		matter)		
		TWA (total	30 mg/m3	OSHA Z-3
		dust)	/ %SiO2+2	
		TWA		
			10 mg/m3	OSHA Z-3
		(respirable)	/ %SiO2+2	
		(respirable) TWA	/ %SiO2+2 250 mppcf	OSHA Z-3
		(respirable) TWA (respirable)	/ %SiO2+2 250 mppcf / %SiO2+5	OSHA Z-3
		(respirable) TWA (respirable) TWA	/ %SiO2+2 250 mppcf	
		(respirable) TWA (respirable) TWA (Respirable	/ %SiO2+2 250 mppcf / %SiO2+5	OSHA Z-3
		(respirable) TWA (respirable) TWA (Respirable fraction)	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA	/ %SiO2+2 250 mppcf / %SiO2+5	OSHA Z-3
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust)	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL (Respirable	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3 0.05 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1 CAL PEL
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL (Respirable dust) TWA	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1
		(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL (Respirable dust)	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3 0.05 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1 CAL PEL
Calcium carbonate	471-34-1	(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL (Respirable dust) TWA (respirable	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3 0.05 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1 CAL PEL
Calcium carbonate	471-34-1	(respirable) TWA (respirable) TWA (Respirable fraction) TWA (Respirable dust) PEL (Respirable dust) TWA (respirable dust)	/ %SiO2+2 250 mppcf / %SiO2+5 0.1 mg/m3 0.05 mg/m3 0.05 mg/m3	OSHA Z-3 OSHA P0 OSHA Z-1 CAL PEL OSHA P0



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0

Revision Date 04/21/2025

!	ı	1,	1	1
		(respirable		
		dust fraction)	- , -	
		TWA	5 mg/m3	NIOSH REL
		(Respirable)	10 / 0	
		TWA (total)	10 mg/m3	NIOSH REL
calcium sulfate	7778-18-9	TWA	5 mg/m3	NIOSH REL
		(Respirable)		
		TWA (total)	10 mg/m3	NIOSH REL
		TWA (total	15 mg/m3	OSHA Z-1
		dust)		
		TWA	5 mg/m3	OSHA Z-1
		(respirable		
		fraction)		
		TWA (Total)	15 mg/m3	OSHA P0
		TWA	5 mg/m3	OSHA P0
		(Respirable		
		fraction)		
		TWA	10 mg/m3	ACGIH
		(Inhalable		
		particulate		
		matter)		
		TWA (Total	15 mg/m3	OSHA P0
		dust)		
		TWA	5 mg/m3	OSHA P0
		(respirable		
		dust fraction)		
		PEL (Total	10 mg/m3	CAL PEL
		dust)		
		PEL	5 mg/m3	CAL PEL
		(respirable		
		dust fraction)		
		TWA	10 mg/m3	ACGIH
		(Inhalable		
		particulate		
		matter)		
Calcium oxide	1305-78-8	TWA	2 mg/m3	ACGIH
		TWA	5 mg/m3	OSHA Z-1
		TWA	5 mg/m3	OSHA P0
		PEL	2 mg/m3	CAL PEL
magnesium oxide	1309-48-4	TWA	10 mg/m3	ACGIH
		(Inhalable		
		particulate		
		matter)		
		TWA (fume,	15 mg/m3	OSHA Z-1
		total		
		particulate)		
		TWA (Total	10 mg/m3	OSHA P0
		particulate)		
		PEL (Fumes)	10 mg/m3	CAL PEL
		TWA (Fume -	10 mg/m3	OSHA P0



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0

Revision Date 04/21/2025

		total		
	1011001	particulate)	1- / 0	00114 7 4
aluminium oxide	1344-28-1	TWA (total dust)	15 mg/m3	OSHA Z-1
		TWA	5 mg/m3	OSHA Z-1
		(respirable		
		fraction)		
		TWA (Total)	10 mg/m3	OSHA P0
		TWA	5 mg/m3	OSHA P0
		(Respirable		
		fraction)		
		TWA	1 mg/m3	ACGIH
		(Respirable		
		particulate		
		matter)		
		TWA (Total	10 mg/m3	OSHA P0
		dust) `	J	
		TWÁ	5 mg/m3	OSHA P0
		(respirable		
		dust fraction)		
		PEL (Total	10 mg/m3	CAL PEL
		dust)		
		PEL	5 mg/m3	CAL PEL
		(respirable	3	
		dust fraction)		
		TWA	1 mg/m3	ACGIH
		(Respirable	3	
		particulate		
		matter)		
diiron trioxide	1309-37-1	TWA	5 mg/m3	ACGIH
		(Respirable		
		particulate		
		matter)		
		TWA	10 mg/m3	OSHA Z-1
		(Fumes)		
		TWA (total	15 mg/m3	OSHA Z-1
		dust)	J	
		TWÁ	5 mg/m3	OSHA Z-1
		(respirable		
		fraction)		
		TWA	10 mg/m3	OSHA P0
		TWA (dust	5 mg/m3	NIOSH REL
		and fume)	3	
		PEL (Total	10 mg/m3	CAL PEL
		dust)	3	
		PEL	5 mg/m3	CAL PEL
		(respirable	,g,e	
		dust fraction)		
		PEL (Fumes)	5 mg/m3	CAL PEL
		TWA	10 mg/m3	OSHA P0



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

(Fumes)

Engineering measures : Use local exhaust ventilation or other engineering controls to

minimize exposures.

Personal protective equipment

Respiratory protection : Use respiratory protection unless adequate risk management

measures (exhaust/ ventilation) are provided or exposure assessment demonstrates that exposures are within

recommended exposure guidelines.

Filter type : Particulates type

Hand protection

Material : butyl-rubber

Eye protection : Safety glasses with side-shields

Skin and body protection : Long sleeved clothing

Remove and wash contaminated clothing before re-use.

Skin should be washed after contact.

Protective measures : Avoid contact with skin.

Hygiene measures : Avoid contact with skin, eyes and clothing.

SECTION 9. PHYSICAL AND CHEMICAL PROPERTIES

Appearance : powder Color : gray Odor : odorless

Odor Threshold : no data available

: is not determined

: is not determined

Flash point : is not determined Evaporation rate : Not applicable

Upper explosion limit : Upper flammability limit

is not determined

Lower explosion limit : Lower flammability limit

is not determined

Density : 1.34 g/cm3

Solubility(ies)

Water solubility : is not determined Partition coefficient: n- : Not applicable



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

octanol/water

Autoignition temperature : is not determined

Viscosity

Viscosity, kinematic : Not applicable

SECTION 10. STABILITY AND REACTIVITY

Chemical stability : The product is chemically stable.

Possibility of hazardous

reactions

Hazardous decomposition

products

: No decomposition if stored and applied as directed.

: Hazardous polymerization does not occur.

SECTION 11. TOXICOLOGICAL INFORMATION

Acute toxicity

Product:

Acute oral toxicity : Acute toxicity estimate : > 5,000 mg/kg

Method: Calculation method

Acute inhalation toxicity : Acute toxicity estimate : > 200 mg/l

Exposure time: 4 Hours Test atmosphere: dust/mist Method: Calculation method

Components:

Ashes (residues):

Acute oral toxicity : LD50 Oral Rat: > 2,000 mg/kg

calcium diformate:

Acute oral toxicity : LD50 Oral Rat: 2,650 mg/kg

diphosphorus pentaoxide:

Acute inhalation toxicity : LC50 Rat: 1.217 mg/l

Exposure time: 1 h

Test atmosphere: dust/mist

Skin corrosion/irritation

No data available

Serious eye damage/eye irritation



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

No data available

Respiratory or skin sensitization

No data available

Germ cell mutagenicity

No data available

Carcinogenicity

No data available

Reproductive toxicity

No data available

STOT-single exposure

No data available

STOT-repeated exposure

No data available

Aspiration toxicity

No data available

SECTION 12. ECOLOGICAL INFORMATION

Ecotoxicity

Components:

calcium sulfate :

Toxicity to fish : LC50 (Pimephales promelas (fathead minnow)): > 1,970 mg/l

Exposure time: 96 h
Test Method: static test

Calcium oxide:

Toxicity to fish : LC50 (Cyprinus carpio (Carp)): 1,070 mg/l

Exposure time: 96 h Test Method: static test

calcium diformate:

Toxicity to fish : LC50 (Brachydanio rerio (zebrafish)): >= 1,000 mg/l

Exposure time: 96 h Test Method: static test

Persistence and degradability

No data available



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

Bioaccumulative potential

Mobility in soil

No data available

Other adverse effects

No data available

SECTION 13. DISPOSAL CONSIDERATIONS

Disposal methods

Waste from residues : To the best of our knowledge, this product does not meet the

definition of hazardous waste under the U.S. EPA Hazardous Waste Regulations 40 CFR 261. Disposal via incineration at an approved facility is recommended, as industry best practice. Consult state, local or provincial authorities for more

restrictive requirements.

The hazard and precautionary statements displayed on the

label also apply to any residues left in the container.

SECTION 14. TRANSPORT INFORMATION

International Regulations

UNRTDG

Not regulated as a dangerous good

IATA-DGR

Not regulated as a dangerous good

IMDG-Code

Not regulated as a dangerous good

Transport in bulk according to Annex II of MARPOL 73/78 and the IBC Code

Not applicable for product as supplied.

Domestic regulation

49 CFR

Not regulated as a dangerous good

SECTION 15. REGULATORY INFORMATION

SARA 311/312 Hazards : Respiratory or skin sensitization

Skin corrosion or irritation

Serious eye damage or eye irritation

Specific target organ toxicity (single or repeated exposure)



TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0 Revision Date 04/21/2025

SARA 302 : This material does not contain any components with a section 302

EHS TPQ.

SARA 313 : This material does not contain any chemical components with known

CAS numbers that exceed the threshold (De Minimis) reporting levels

established by SARA Title III, Section 313.

Clean Air Act

The following chemical(s) are listed as HAP under the U.S. Clean Air Act, Section 112 (40 CFR

61):

Manganese dioxide 1313-13-9

US State Regulations

California Prop 65 Please contact Supplier for more information.

The ingredients of this product are reported in the following inventories:

TSCA All substances listed as active on the TSCA inventory

All components of this product are on the Canadian DSL

Please reach out to TEC Specialty Products LLC for further information regarding chemics

Please reach out to TEC Specialty Products LLC for further information regarding chemical inventories not listed above. **Inventories Legend**TSCA (USA), DSL (Canada), REACH(Europe), AIIC (Australia), NZIoC (New Zealand), ENCS (Japan), KECI (Korea), PICCS (Philippines),

IECSC (China), TWINV (Taiwan)

SECTION 16. OTHER INFORMATION




TEC® ULTIMATE 382 ULTIMATE LG TILE MORTAR GRAY

Version 1.0

Revision Date 04/21/2025

Further information



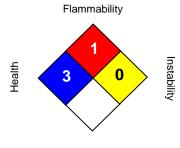

Special hazard

HMIS III:

HEALTH	3/
FLAMMABILITY	1
PHYSICAL HAZARD	0

0 = not significant, 1 =Slight, 2 = Moderate, 3 = High 4 = Extreme, * = Chronic